

RSP 1068, RSX 1056 and RSX 1067 Software Updates

Release Notes

V1.1.0 to V1.1.1

- Corrected some terms for the Italian and German languages.

V1.1.1 to V1.1.2

- Corrected some terms on the Speaker Display.

V1.1.2 to V1.1.3

- Added Dolby Pro Logic IIx format.
- Changed contour setting to make any contour adjustments made via the Tone button on the remote a temporary adjustment. Permanent contour adjustments can be made via the Contour menu on the OSD.

V1.1.3 to V1.1.4

- Improved 12 volt trigger assignment to allow fully independent 12V operation with both main and second zones. Refer to the Technical Updates section for more details on this.
- Level adjustment of PLIIx surround center back levels.

V1.1.4 to V1.1.5

- Adjusted the output levels in Dolby 3 Stereo mode

V1.1.5 to V1.1.7

- Corrected a discrepancy between the front display and the OSD when displaying the Dolby Digital 2CH mode.
- Corrected the Dolby Digital EX flag indication when using RS232.
- Changed the default surround mode method to remember the last used surround mode by disc type - i.e. separate default modes now available for Dolby Digital and DTS. The exceptions to this are auto-detected surround modes such as DD EX and DTS ES discs.
- Corrected a bug causing no progressive component video passthrough on initial powerup when OSD is set to off.

V1.1.7 to V1.1.9

- Added Dolby Pro Logic II Game Mode.
- Dolby Pro Logic II Emulation changed to Dolby Pro Logic.
- Improved volume speed in both main Zone and Zone 2 via remote control.
- Added User Default Password feature. **NOTE:** The default password is '0000'.
- Added Factory Default confirmation screen to the OSD.
- Corrected a bug to allow Zone 2 control via RS232 when the main zone is in standby.
- Updated 7CH Stereo DSP mode's center back channel outputs from mono to stereo (requires EPROM flash for this update. If you do not use 7CH stereo this EPROM flash is not required for further updates.)

V1.2.0 to V1.2.1

- Fixed an intermittent problem of units locking into “Standby” mode until the rear panel power toggle was engaged.
- Improved digital input sensing and format detection. This improvement fixes any problems with no audio when changing channels with some Scientific Atlanta HD digital cable boxes.

V1.2.1 to V1.2.2

- Corrected an error in V1.2.1 which caused very low center channel output when switching between DD/PLII to PLII modes.

V1.2.2 to V1.2.3

- Corrected an error that would allow zone 2 to be turned on in an incorrect state by selecting an input when the main zone is in standby.
- Deleted the Pro Logic icon when playing a DD2CH or PCM digital source, per Dolby’s request.

V1.2.3 to V1.2.4

- Improved memory backup software
- Added Pro Logic icon for 6.1/7.1 Dolby modes

V1.2.4 to V1.2.5

- Fixed a bug that caused audio dropouts from digital sources when controlling volume via RS232.